

Materials Recovery Facility Safety Observation Form

Date: Saturday, July 2nd, 2016


Name of Observer: Shawn Qualls


Issues: See below.

Photos:



Damaged regulator: repair or replace [4.4.10.1, ANSI Z49.1]

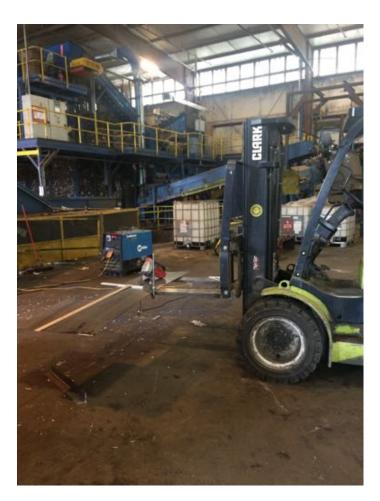

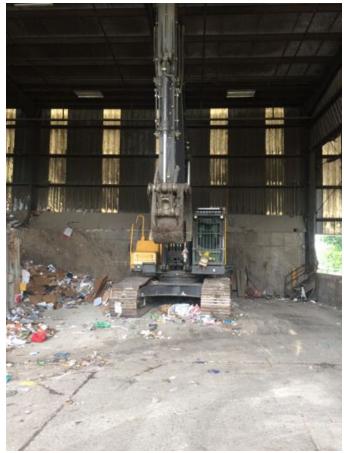



Top left:

- Forks left raised while left unattended [MIOSHA 2174]
- Improper load balancing
- Forks used as working surface? If so, hot work (cutting) taking place within 35' of combustibles. Also, no permit posted.

Top right: (Empty?) LP tank: improper storage.

• Tank left, unsecured, atop forklift.

Bottom: Grapple raised while left unattended [MIOSHA 2174]

2 MRF INSPECTION - 07/02/2016







Top left: rebar protruding from overturned parking blocks

Top right: Hot work taking place (inside bailer/conveyer), no permit posted

Bottom: Materials stacked improperly







Top (both): fall protection inspection tags show no inspections

Bottom: improper materials storage








Top (both): Missing fire extinguisher

Bottom:

- Fire extinguisher in (rented) aerial lift has damaged handle
- Tag shows no inspections performed
- No inspection log aboard vehicle

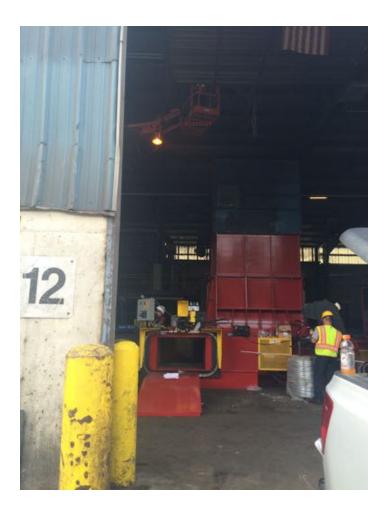

Left: Workers working directly underneath aerial lift basket; area around lift should be taped off with red danger tape

Below: forklift left unattended with forks raised [MIOSHA 2174]





Left: No fall protection

Below: Poor work positioning, worker standing on mid-rail, leaning over the edge of the bucket, with no fall protection.

(abated immediately)

