



Materials Recovery Facility
Safety Observation Form

Date: Thursday, June 23, 2016

Name of Observer: Shawn Qualls

Issues: See below.

Photos:





Improper chemical storage:

- Placed in pinch-point between wall and mobile equipment
- No labels



All:

- Dust & debris built up atop electrical equipment – fire hazard
- Cover not secured
- Improper labeling [1910.303(e)]



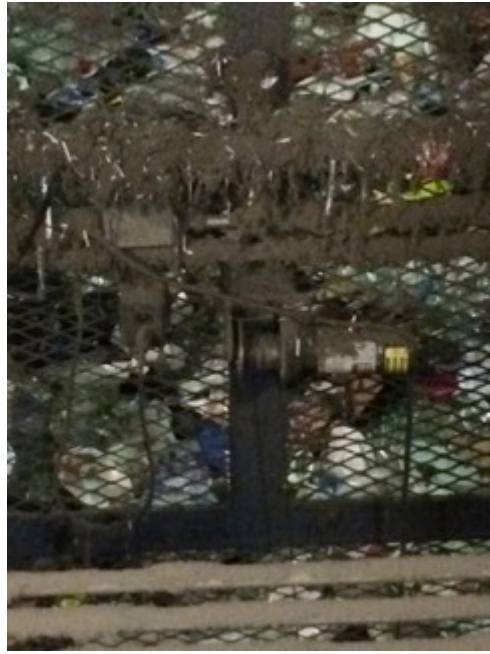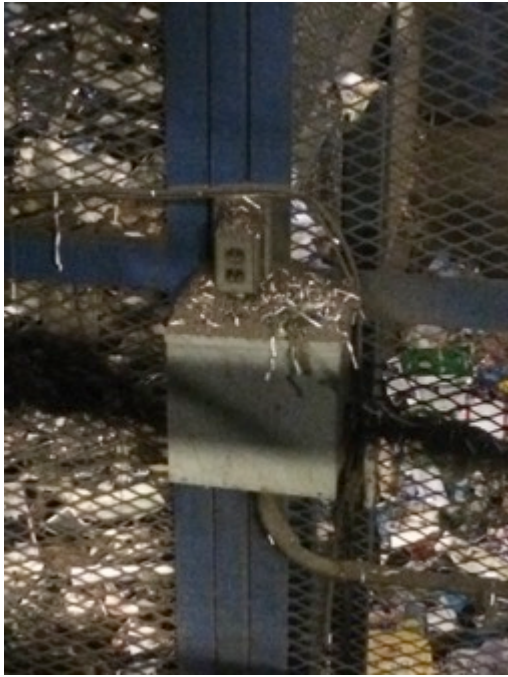


All: Dust & debris atop electrical equipment – fire hazard

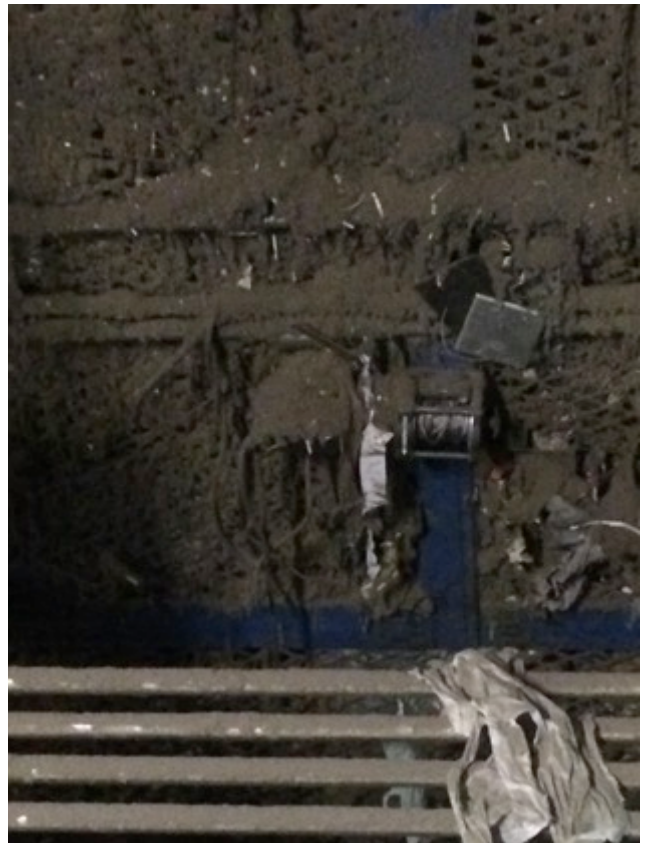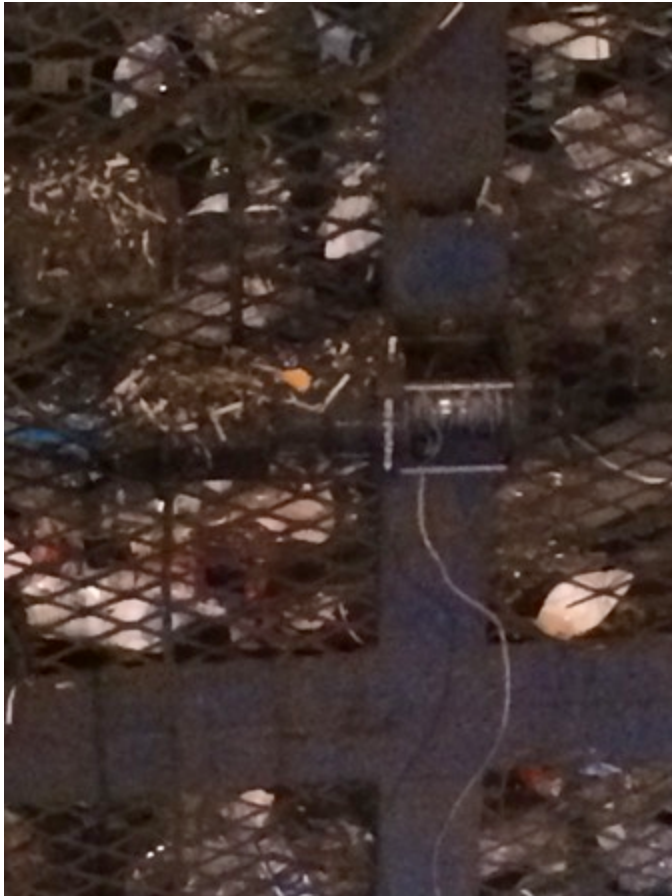




All: Dust & debris in/on/around electric motors. Susceptible to overheating/failure; fire hazard

Top left & middle: metal caps not secured, screws missing

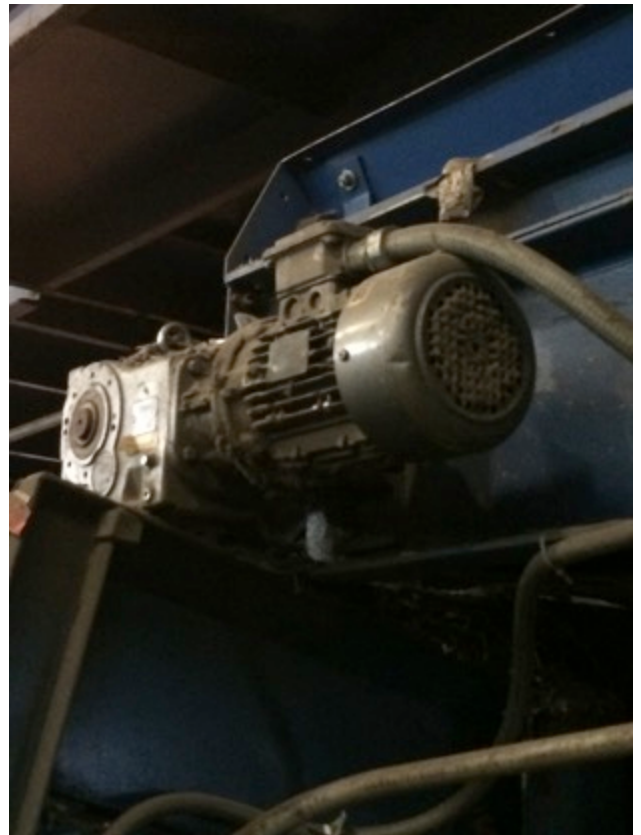

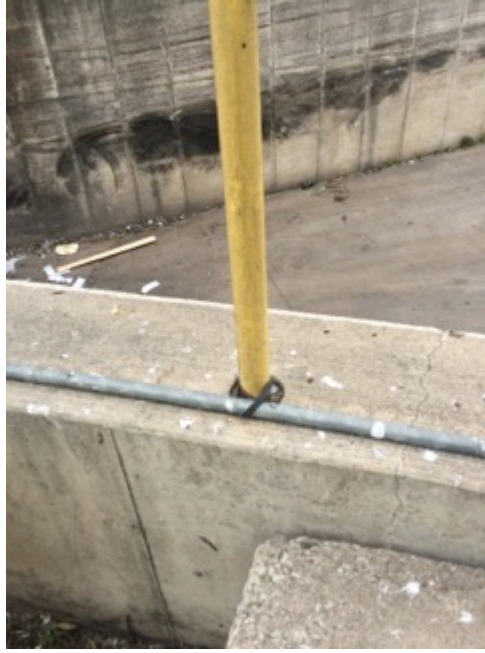

Left: GFCI

- Improperly secured to railing
- No cover

Right: Improperly secured



Bottom:

- Broken extension cord w/ exposed leads
- Cord not removed and stored immediately after use
[1910.305(a)(2)(ii)]



All: Improper materials storage/poor housekeeping

Bottom: Container not labeled






Top:

- Exposed wiring
- Damaged switch
- Cover not secured
- Improper labeling



Bottom:

- Damaged conduit
- Proximity to drainage pipe



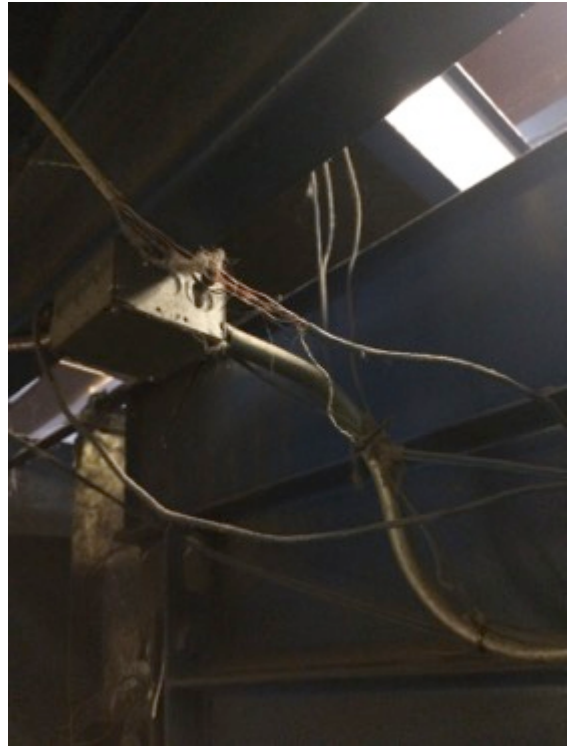


All: Exposed wiring
Bottom right: dust/debris build-up

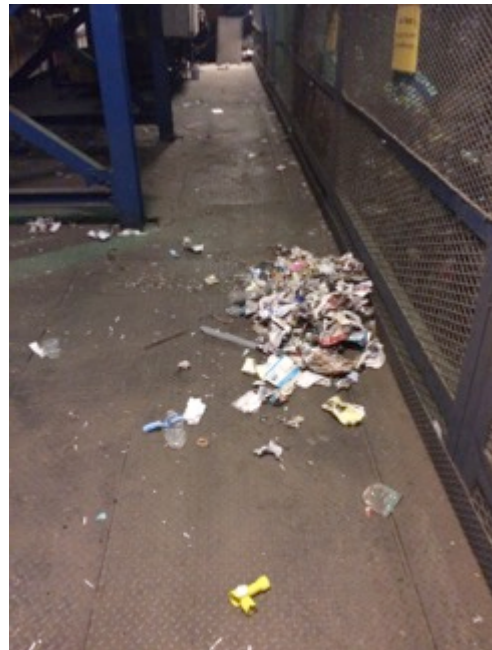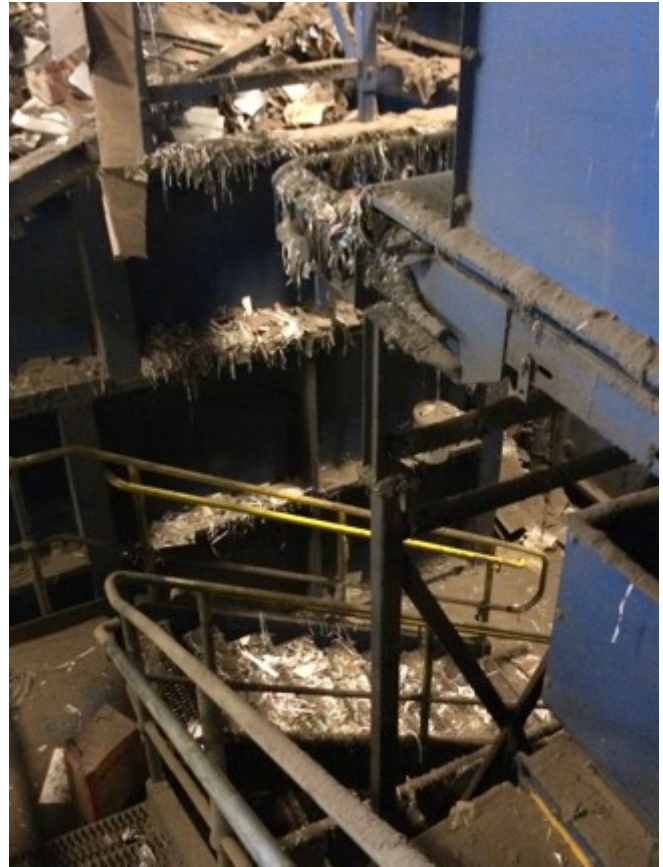

All:

- Walkways/stairways blocked
- Poor housekeeping

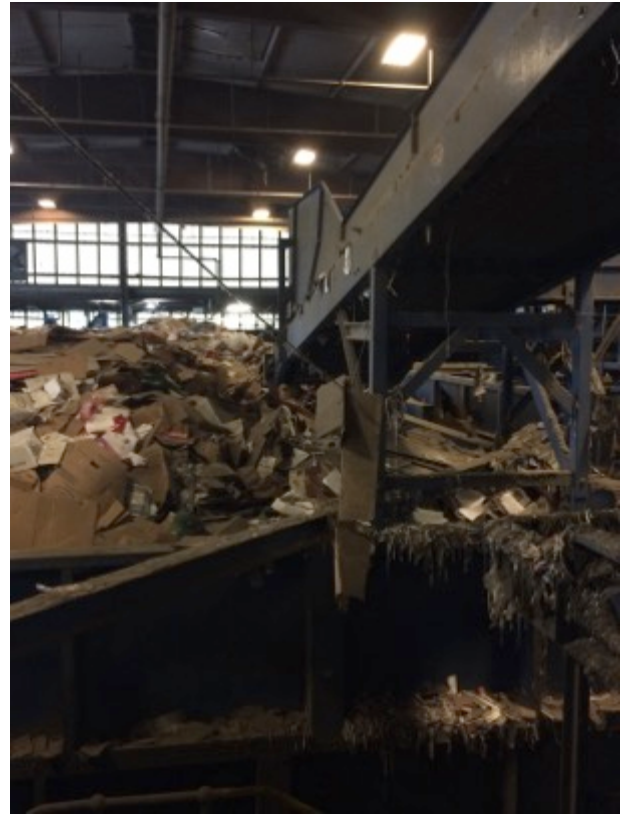

Top left: dust/debris built up atop heater – fire hazard

Top right: wiring strung over/underneath machinery, large piece of cardboard got caught on it.

Bottom: moving part left unguarded



Top left: Not properly labeled

Top right: high-voltage line not secured

Bottom: lockers set on uneven surface, potential crush hazard.